


Connection Dimensions


Insulated output drive

DREHMO
VALVE ACTUATORS


Output drive form
B1, B2, B
Plug bush for
rising spindle *

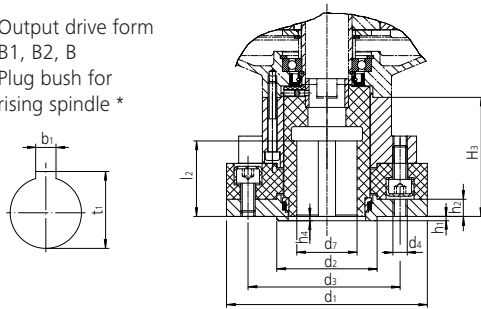


Output drive form
B3, B4, E *

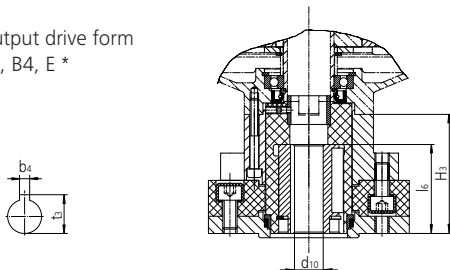

Output drive
form C
claw coupling *

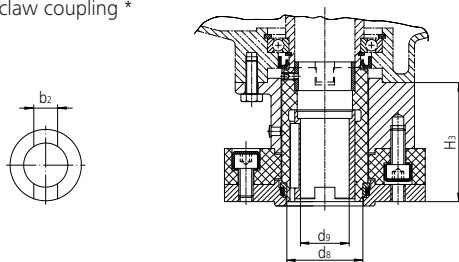

Output drive form D
shaft extension *

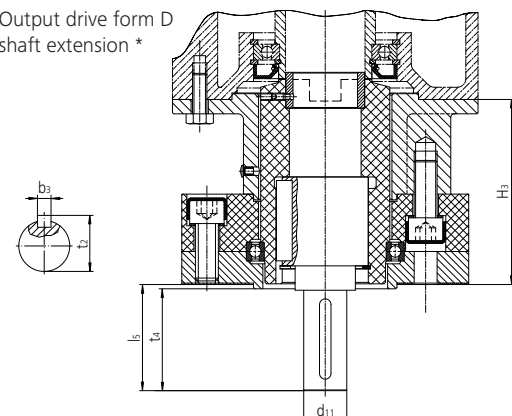

Actuator D...		30 59	60 120 249	60 120 249	250 500	250 500	1000
Actuator D...R		30 59	60 120	60 120	250 500	250 500	1000
Größe	DIN EN ISO 5210	F10	F10	F14	F14	F16	F16
	DIN 3210	G0	G0	G1/2	G1/2	G3	G3
Dimensions [mm]							
d1	FORM B1,B, B2	125	125	175	175	210	210
d2 _{ts}	DIN EN ISO	70	70	100	100	130	130
	DIN 3210	60	60	100	100	130	130
d3		102	102	140	140	165	165
d4	4 x	M10	M10	M16	M16	M20	M20
h2		13	13	23	23	65	65
l2		54	56	67	67	67	114
b1 ^{ISO}		12	12	18	18	22	22
d7 ^{H9}		42	42	60	60	80	80
d7 _{max}		42	42	60	65	80	80
H3		83	83	133	129	195	195
h1 = h4		3	3	4	4	5	5
t1		45,3	45,3	64,4	64,4	85,4	85,4

b4 ^{ISO}	FORM B3, B4, E	6	6	8	12	12	12
d10 ^{H9}		20	20	30	40	40	40
d10 _{max}		16	30	30	40	50	50
H3		83	83	133	129	195	196
l6		62	62	75	75	98	114
t3		22,8	22,8	33,3	43,3	43,3	43,3

* missing dimensions see form B, B1, B2

b2 ^{H11}	FORM C	-	14	20	20	-	-
d8		-	53	84	84	-	-
d9		-	34	46	46	-	-
H3		-	83	133	129	-	-

* missing dimensions see form B, B1, B2

b3 _{h9}	FORM D	-	-	-	8	-	-
d11		-	-	-	30	-	-
H3		-	-	-	129	-	-
t4		-	-	-	71	-	-
l5		-	-	-	74	-	-
t2		-	-	-	33	-	-

* missing dimensions see form B, B1, B2